



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246



D407-667-205TRN
Job Sheet 189277



Part No: D407-667-205TRN

Job Qty: 1 pcs

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 1/22/19

Job Tracking No:

Due Date: 2/8/19

Created By: Jesse White

Type: Stock

Description:

Note: DWG REV G IPP Rev:A 08-03-06 new issue DD verified by:ec IPP Rev B 08.04.02 Removed polish EC verified by: DD IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Lead Time	Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier			
100	Mori Seiki TL-40 - 1	1 pcs	2/8/19	2/8/19	2.49	3.20	Mori Seiki TL-40 - 1			DAS 66 2019-02-04
110	QC 2	1 pcs	2/8/19	2/8/19	0.00	0.00	QC 2 - 1			99-89
							QC 2 - 12			
							QC 2 - 14			
							QC 2 - 17			
							QC 2 - 19			
							QC 2 - 2			
							QC 2 - 20			
							QC 2 - 22			
							QC 2 - 23			
							QC 2 - 25			
							QC 2 - 32			
							QC 2 - 33			
							QC 2 - 35			
							QC 2 - 38			
							QC 2 - 39			
							QC 2 - 4			
							QC 2 - 40			
							QC 2 - 44			
							QC 2 - 45			
							QC 2 - 48			
							QC 2 - 49			
							QC 2 - 50			
							QC 2 - 51			
							QC 2 - 52			
							QC 2 - 54			
							QC 2 - 56			
							QC 2 - 57			
							QC 2 - 62			
							QC 2 - 63			

QC 2-66
DAS 66 9-89 2019-02-04

Plex 1/22/19 10:57 AM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function		FAULT CATEGORY ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

				QC 2 - 8	DAS					
120	Mori Seiki TL-40 - 1 - B4B	1 pcs	2/8/19	0.00 0.00	Mori Seiki TL-40 - 1 - B4B	66 2019-02-04				
130	QC 2	1 pcs	2/8/19	0.00 0.00	QC 2 - 1	9-89				
QC 2-66 DAS 66 9-89 2019-02-04				QC 2 - 12						
				QC 2 - 14						
				QC 2 - 17						
				QC 2 - 19						
				QC 2 - 2						
				QC 2 - 20						
				QC 2 - 22						
				QC 2 - 23						
				QC 2 - 25						
				QC 2 - 32						
				QC 2 - 33						
				QC 2 - 35						
				QC 2 - 38						
				QC 2 - 39						
				QC 2 - 4						
				QC 2 - 40						
				QC 2 - 44						
				QC 2 - 45						
				QC 2 - 48						
				QC 2 - 49						
				QC 2 - 50						
				QC 2 - 51						
				QC 2 - 52						
				QC 2 - 54						
				QC 2 - 56						
				QC 2 - 57						
				QC 2 - 62						
				QC 2 - 63						
				QC 2 - 8						
				140	QC 8	1 pcs	2/8/19	0.00 0.00	QC 8 - 12	
								QC 8 - 14		
								QC 8 - 17		
QC 8 - 20										
QC 8 - 25										
QC 8 - 3										
QC 8 - 32										
QC 8 - 33										
QC 8 - 35										
QC 8 - 38										
QC 8 - 39										
QC 8 - 4										
QC 8 - 44										
QC 8 - 45										
QC 8 - 49										
QC 8 - 58										
QC 8 - 8										
QC 8 - 9										
QC 8 - 68										
QC 8 - 67	GP 19-02-05									
QC 8 - 1 (A)										
145	Crosstubes - 2 - B4B	1 pcs	2/8/19					0.00 0.65	Crosstubes - 1 - B4B	
								Crosstubes - 2 - B4B	GP 19-02-05	
								Crosstubes - 3 - B4B		
								Crosstubes - 4 - B4B		
				Crosstubes - 5 - B4B						
				Crosstubes - 6 - B4B						

Plex 1/22/19 10:57 AM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

150	Crosstubes - 3 - B4B	1 pcs	2/8/19	0.00 0.25	Crosstubes - 1 - B4B	D.R.19/02/15
					Crosstubes - 2 - B4B	
					Crosstubes - 3 - B4B	
					Crosstubes - 4 - B4B	
					Crosstubes - 5 - B4B	
					Crosstubes - 6 - B4B	
160	QC 7	1 pcs	2/8/19	0.00 0.00	QC 7 - 10	DAS 67 9-89 19-02-06
					QC 7 - 13	
					QC 7 - 14	
					QC 7 - 15	
					QC 7 - 17	
					QC 7 - 18	
					QC 7 - 19	
					QC 7 - 2	
					QC 7 - 28	
					QC 7 - 3	
					QC 7 - 30	
					QC 7 - 34	
					QC 7 - 36	
					QC 7 - 37	
					QC 7 - 38	
					QC 7 - 41	
					QC 7 - 47	
					QC 7 - 48	
					QC 7 - 51	
					QC 7 - 58	
					QC 7 - 59	
					QC 7 - 6	
					QC 7 - 60	
					QC 7 - 9	
					QC 7 - 68	
					QC 7 - 50	
					QC 7 - 67	
170	Packaging 3-1 - Stock - B4B	1 pcs	2/8/19	0.00 0.00	Packaging 3 - 1 - B4B	
					Packaging 3 - 2 - B4B	
					Packaging 3 - 3 - B4B	
					Packaging 3 - 4 - B4B	
					Packaging 3 - 5 - B4B	
					Packaging 3 - 6 - B4B	
					Packaging 3 - 7 - B4B	
					Packaging 3 - 8 - B4B	
					Packaging 3 - 9 - B4B	
					Packaging 3 - 10 - B4B	
					Packaging 3 - 11 - B4B	
					Packaging 3 - 12 - B4B	
					Packaging 3 - 13 - B4B	
					Packaging 3 - 14 - B4B	
					Packaging 3 - 15 - B4B	
					Packaging 3 - 16 - B4B	
					Packaging 3 - 17 - B4B	
					Packaging 3 - 18 - B4B	
					Packaging 3 - 19 - B4B	
					Packaging 3 - 20 - B4B	
					Packaging 3 - 21 - B4B	
					Packaging 3 - 22 - B4B	
					Packaging 3 - 23 - B4B	
					Packaging 3 - 24 - B4B	
					Packaging 3 - 25 - B4B	
					Packaging 3 - 26 - B4B	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	DAS
				Packaging 3 - 34 - B4B	21
				Packaging 3 - 35 - B4B	9-85 FEB 06 2019
180 QC 21 - SA	1 pcs	2/8/19	0.00 0.00	QC 21 - SA - 21	DAS
				QC 21 - SA - 70	21 FEB 06 2019

Part Op **100** - Mori Seiki CNC Lathe Large) 1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248 3-Turn Descriptions: first side as per Folio FA248

110 - (QC2- Inspect parts off machine FAI/FAIB)

120 - (Mori Seiki CNC Lathe Large) 1-Turn second side as per Folio FA248 4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245

130 - (QC2- Inspect parts off machine FAI/FAIB)

140 - (QC8- Inspect parts - second check)

145 - (Crosstubes) Grind off circumferential machining marks longitudinally.

150 - (Crosstubes) 1- handfinish X-TUBE INSIDE AND OUT 2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

160 - (QC7-Inspect Chemical Conversion Coat)

170 - Identify and stock in kanban rack

180 - (QC21- Final Inspection - Work Order Release)

Job BOM				
Part / Item	Component Name	Quantity	Operation	Container
D6011-115	Crosstube Material	1 pcs (1 ea)	100-Mori Seiki TL-40 - 1	S006659

Job Allocations				
Operation	Component Part	Required	Inventory	Allocated
100-Mori Seiki TL-40 - 1	D6011-115	1	67	0

Part Specifications	
Specifications could not be found.	

Plex 1/22/19 10:57 AM dart.white.jesse



Container No: S150371



Part: D407-667-205TRN

Job No: 189277

Serial No/Batch: S150371

Revision: G

Inspector:

Exp Date:

Instructions:

DART Aerospace Ltd.
 1270 Aberdeen Street
 Hawkesbury, ON K6A 1K7
 CANADA
 TEL.: 1 813 632-5200
 Email: sales@dartaero.com
 www.dartaerospace.com

Date: 02/04/19

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

②

DART AEROSPACE LTD	Work Order: 189277
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.490	✓		CNC-04	
	1.832	+0.005/-0.000	1.833	✓		CNC-08	
	1.838	+0.005/-0.000	1.838	✓		↓	
	1.892	+0.005/-0.000	1.892	✓		↓	
	2.052	+0.005/-0.000	2.054	✓		CNC-04	
	2.206	+0.005/-0.000	2.211	✓		↓	
	2.521	+0.005/-0.000	2.526	✓		↓	
	2.633	+0.005/-0.000	2.638	✓		↓	
	4.10	+/-0.030	4.110	✓		CNC-08	
	4.978	+/-0.030	4.988	✓		↓	
	2.040	+0.000/-0.010	2.040	✓		↓	
	0.125	+/-0.010	.120	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		"	
SIDE B	2.490	+0.005/-0.000	2.494	✓		CNC-04	
	1.832	+0.005/-0.000	1.837	✓		CNC-08	
	1.838	+0.005/-0.000	1.842	✓		↓	
	1.892	+0.005/-0.000	1.897	✓		↓	
	2.052	+0.005/-0.000	2.057	✓		CNC-04	
	2.206	+0.005/-0.000	2.211	✓		↓	
	2.521	+0.005/-0.000	2.526	✓		↓	
	2.633	+0.005/-0.000	2.638	✓		↓	
	4.10	+/-0.030	4.091	✓		CNC-08	
	4.978	+/-0.030	4.882	✓		↓	
	2.040	+0.000/-0.010	2.037	✓		↓	
	0.125	+/-0.010	.128	✓		↓	
	R0.063	+/-0.010	.063	✓		RG	
	R0.500	+/-0.010	.500	✓		RG	
	112.91	+/-0.020	112.900	✓		Tape	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

②

DART AEROSPACE LTD		Work Order: 189277
Description: Crosstube Assembly		Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G		Page 2 of 2

WALL THICKNESS MEASUREMENT

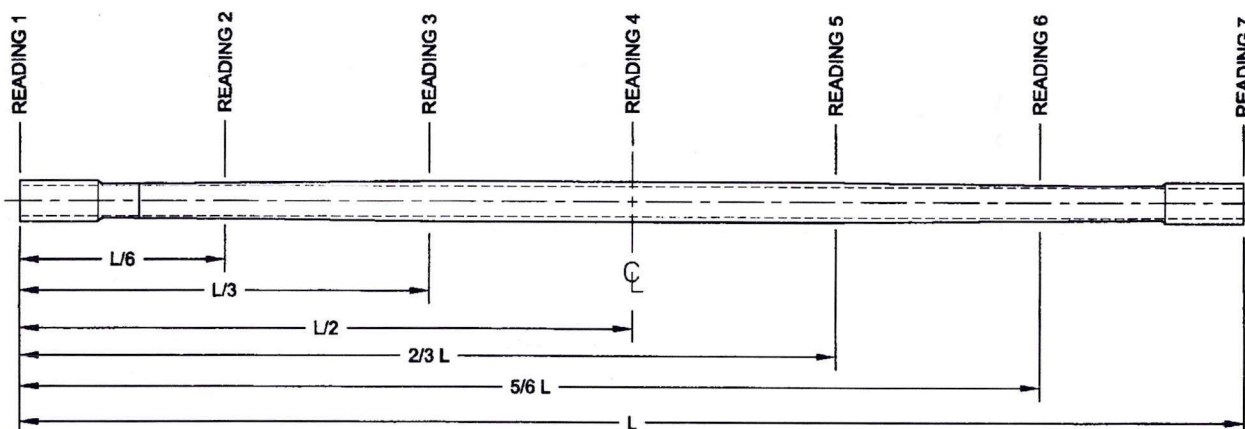

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.228	.228	.228	.227	.001	0.075"
READING 2 L= 18.82	.250	.247	.231	.233	.019	
READING 3 L= 37.64	.428	.424	.408	.409	.020	
READING 4 L= 56.46	.648	.648	.651	.659	.011	
READING 5 L= 75.27	.411	.403	.411	.422	.019	
READING 6 L= 94.09	.231	.233	.244	.242	.013	
READING 7 L= 112.91	.222	.226	.226	.223	.004	

Calibration Result

Actual Block Thickness: 100-750

Sitescan 250 Measured Thickness: 100-750

Measured by: MD	Audited by: DAS 67	Preliminary Approval:
Date: 2019-02-04	Date: 19-02-05	Date:

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	
G	15.05.14	Dwg Rev updated	KJ	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐																															
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)																													
Description Work Order Deviation				Disposition		Completed By																													
						Lead hand / Supervisor																													
						QC / QA Coordinator																													
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY <table border="0"><tr><td>☐ Pressure/Forced</td><td>☐ Contamination</td><td>☐ Power Loss/Surge</td><td>☐ Positioned Wrong</td></tr><tr><td>☐ Bending</td><td>☐ Misaligned/off center</td><td>☐ Folio/Program</td><td>☐ Outside Tolerance</td></tr><tr><td>☐ Crushing</td><td>☐ BOM/Route</td><td>☐ Grain Direction</td><td>☐ Drawing</td></tr><tr><td>☐ Cracks</td><td>☐ Broken/Damage/Defect</td><td>☐ Weld</td><td>☐ Finish</td></tr><tr><td>☐ Crimp/Kink/Ripple/Wave/Twist</td><td>☐ Incomplete/Unclear Instructions</td><td>☐ Wrong Stock Pulled</td><td>☐ Part Lost/Missing</td></tr><tr><td>☐ Marks/Chatter</td><td>☐ Drill Holes</td><td>☐ Out of Sequence</td><td>☐ Misread</td></tr><tr><td>☐ Mislabeled</td><td>☐ Fit/Function</td><td>☐ Off-set/Set-up</td><td></td></tr></table>						☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																	
Other/Details: _____																																			

8 7 6 5 4 3 2 1

Item	QTY -245	PART NUMBER	DESCRIPTION
	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
1	1	D6011-115	CROSSTUBE
2	2	D2873-043	NUT PLATE
3	2	D2873-045	NUT PLATE
4	1	D2894-1	SUPPORT
5	2	D3190-1	CHAFING SHIELD
6	2	D3595-063-430	RUBBER CUSHION
7	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
8	4	MS21920-22	CLAMP
9	2	MS21920-25	CLAMP (OR MS21920-24)
10	AR	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
11	AR	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT CROSSTUBE PER DART QSI 005 4.2
FOR HATCHED AREAS (ZN A6-2), MASK AS REQUIRED
TO APPLY PRIME AND APPLY CLEAR COAT ONLY
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1 CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS 50 TO 70 DEGREES FROM BOTTOM OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. TORQUE CLAMPS ON D3190-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

RELEASED

2015 APR 09
4P ECN 15-557

G	INCORP. DEO's D407-667-245-F1/F2 (ZN D8-1, A8-1, D5-2, B6-2, C6-2); 8.90 WAS 8.53 (ZN D5-2); TORQUE REDUCED FOR CHAFING SHIELD (ZN A8-1); FINISH REVISED TO ALLOW MANUFAC. FLEXIBILITY (ZN C8-1)	RF	15.03.20
F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNABOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	4P		
DRAWN	RF		
CHECKED	4P		
MFG. APPR.	4P		
APPROVED	4P		
DE APPR.	4P		
DATE	15.03.20		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA		REV. G	
DRAWING NO. D407-667-245		SHEET 1 OF 4	
TITLE CROSSTUBE ASSY (407 HIGH AFT)		SCALE	NTS
COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

Entered: _____ Date: _____









WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

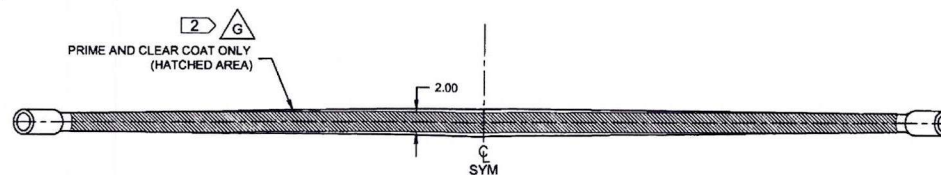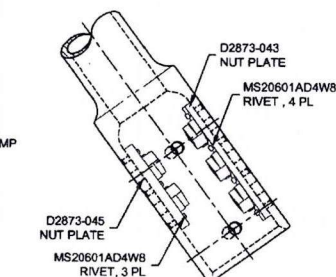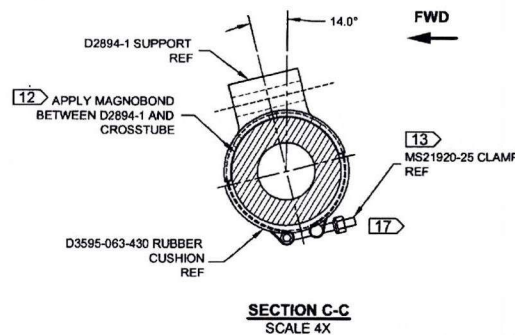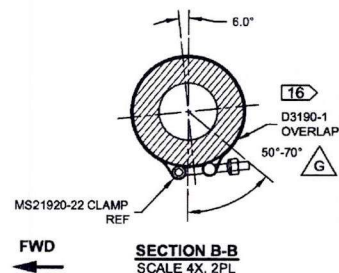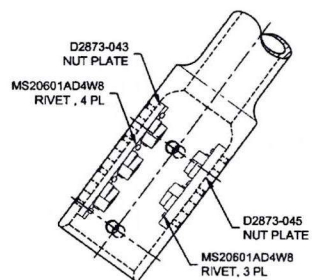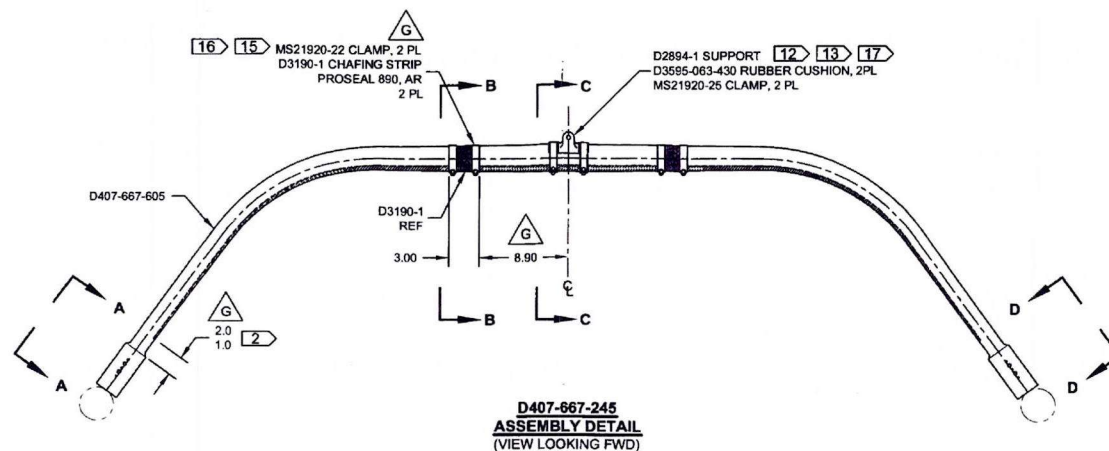

RELEASED
2015 APR 09

DESIGN	q	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	q	DRAWING NO.	REV. G
MFG. APPR.	q	D407-667-245	SHEET 2 OF 4
APPROVED	q	TITLE	SCALE
DE APPR.	q	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


SEE DETAIL M

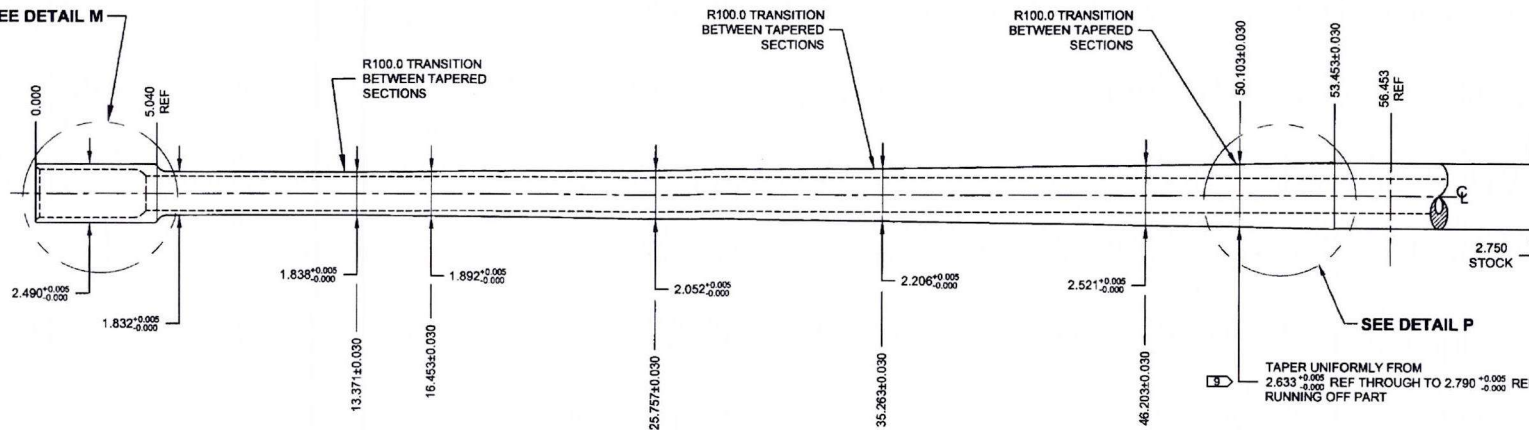


D407-667-245 MACHINING DETAIL

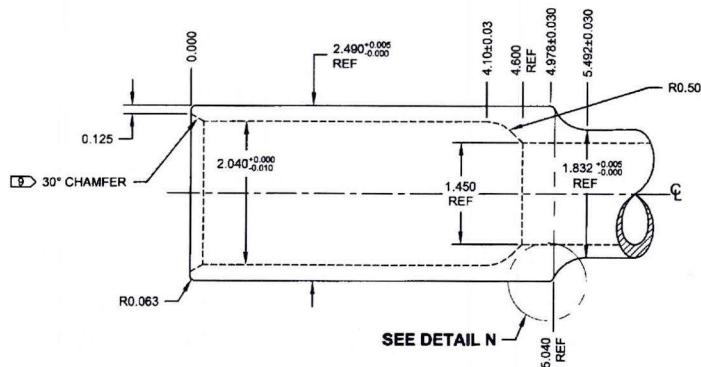

DETAIL M: CROSSTUBE CUFF
SCALE 3X

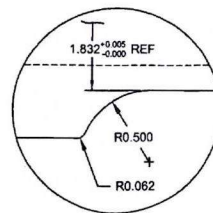

DETAIL N: CUFF TRANSITION
SCALE 2X

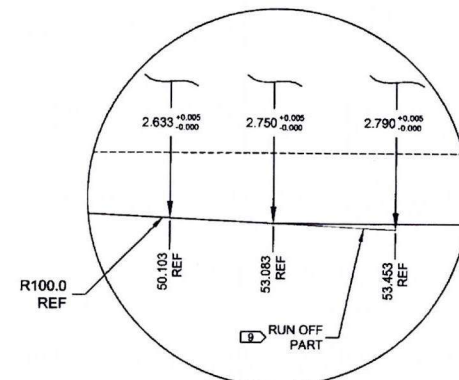

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

RELEASED

2015 APR 09

DESIGN	Q	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	Q	DRAWING NO.	REV. G
MFG. APPR.	Q	D407-667-245	SHEET 4 OF 4
APPROVED	Q	TITLE	SCALE
DE APPR.	Q	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					